11/18/2020

City: Camarillo - Department of Community Development Jaclyn Lee 601 Carmen Drive, Camarillo, CA 93010, USA jlee@cityofcamarillo.org

Construction Site Well Review (CSWR) ID: 1012171

Assessor Parcel Number(s): 234004042, 234004059, 234004074, 234004075, 234004076,

234004077, 234018111, 234020104, 234020105

Property Owner(s): Multiple property owners

Project Location Address: 791 Camarillo Springs Road, Camarillo, California, 93012

Project Title: CAMARILLO SPRINGS GPA 2017-2 EIR 2020-10 • SCH #2019070514

Public Resources Code (PRC) § 3208.1 establishes well reabandonment responsibility when a previously plugged and abandoned well will be impacted by planned property development or construction activities. Local permitting agencies, property owners, and/or developers should be aware of, and fully understand, that significant and potentially dangerous issues may be associated with development near oil, gas, and geothermal wells.

The Division of Oil, Gas, and Geothermal Resources (Division) has received and reviewed the above referenced project dated 9/22/2020. To assist local permitting agencies, property owners, and developers in making wise land use decisions regarding potential development near oil, gas, or geothermal wells, the Division provides the following well evaluation.

The project is located in Ventura County, within the boundaries of the following fields:

Conejo (ABD)

The project underwent an initial review by this office and a letter was issued July 26, 2019. This review includes previously reviewed wells and now includes wells in the proposed redesigned golf course.

One well appears in the Draft Environmental Impact Report (Figure 4-6, Lot 160) that is not in CalGEM records. If a well is known to be or has been found at this location, please contact this office for recommendations..

CalGEM well location data are approximate. Well locations should be confirmed prior to any development and tested for leakage.

The September 2020 Draft Environmental Impact Report indicates re-grading of the ground surface in the golf course area. This action will bring multiple wells out of compliance with California Code of Regulations § 1723.5 (specific wells noted in table below).

Our records indicate there are 72 known oil or gas wells located within the project boundary as identified in the application.

- Number of wells Not Abandoned to Current Division Requirements as Prescribed by Law and Projected to Be Built Over or Have Future Access Impeded by this project: 12
- Number of wells Not Abandoned to Current Division Requirements as Prescribed by Law and Not Projected to Be Built Over or Have Future Access Impeded by this project: 59
- Number of wells Abandoned to Current Division Requirements as Prescribed by Law and Projected to Be Built Over or Have Future Access Impeded by this project: 0
- Number of wells Abandoned to Current Division Requirements as Prescribed by Law and Not Projected to Be Built Over or Have Future Access Impeded by this project: 1

The Division categorically advices against building over, or in any way impeding access to, oil, gas, or geothermal wells. Impeding access to a well could result in the need to remove any structure or obstacle that prevents or impedes access including, but not limited to, buildings, housing, fencing, landscaping, trees, pools, patios, sidewalks, roadways, and decking. Maintaining sufficient access is considered the ability for a well servicing unit and associated necessary equipment to reach a well from a public street or access way, solely over the parcel on which the well is located. A well servicing unit, and any necessary equipment, should be able to pass unimpeded along and over the route, and should be able to access the well without disturbing the integrity of surrounding infrastructure.

There are no guarantees a well abandoned in compliance with current Division requirements as prescribed by law will not start leaking in the future. It always remains a possibility that any well may start to leak oil, gas, and/or water after abandonment, no matter how thoroughly the well was plugged and abandoned. The Division acknowledges wells plugged and abandoned to the most current Division requirements as prescribed by law have a lower probability of leaking in the future, however there is no guarantees that such abandonments will not leak.

The Division advises that all wells identified on the development parcel prior to, or during, development activities be tested for liquid and gas leakage. Surveyed locations should be provided to the Division in Latitude and Longitude, NAD 83 decimal format. The Division expects any wells found leaking to be reported to it immediately.

Failure to plug and reabandon the well may result in enforcement action, including an order to perform reabandonment well work, pursuant to PRC § 3208.1, and 3224.

PRC § 3208.1 give the Division the authority to order or permit the re-abandonment of any well where it has reason to question the integrity of the previous abandonment, or if the well is not accessible or visible. Responsibility for re-abandonment costs may be affected by the choices made by the local permitting agency, property owner, and/or developer in considering the general advice set forth in this

letter. The PRC continues to define the person or entity responsible for reabandonment as:

- 1. The property owner If the well was plugged and abandoned in conformance with Division requirements at the time of abandonment, and in its current condition does not pose an immediate danger to life, health, and property, but requires additional work solely because the owner of the property on which the well is located proposes construction on the property that would prevent or impede access to the well for purposes of remedying a currently perceived future problem, then the owner of the property on which the well is located shall obtain all rights necessary to reabandon the well and be responsible for the reabandonment.
- 2. The person or entity causing construction over or near the well If the well was plugged and abandoned in conformance with Division requirements at the time of plugging and abandonment, and the property owner, developer, or local agency permitting the construction failed either to obtain an opinion from the supervisor or district deputy as to whether the previously abandoned well is required to be reabandoned, or to follow the advice of the supervisor or district deputy not to undertake the construction, then the person or entity causing the construction over or near the well shall obtain all rights necessary to reabandon the well and be responsible for the reabandonment.
- 3. The party or parties responsible for disturbing the integrity of the abandonment If the well was plugged and abandoned in conformance with Division requirements at the time of plugging and abandonment, and after that time someone other than the operator or an affiliate of the operator disturbed the integrity of the abandonment in the course of developing the property, then the party or parties responsible for disturbing the integrity of the abandonment shall be responsible for the reabandonment.

No well work may be performed on any oil, gas, or geothermal well without written approval from the Division. Well work requiring approval includes, but is not limited to, mitigating leaking gas or other fluids from abandoned wells, modifications to well casings, and/or any other re-abandonment work. The Division also regulates the top of a plugged and abandoned well's minimum and maximum depth below final grade. CCR §1723.5 states well casings shall be cut off at least 5 feet but no more than 10 feet below grade. If any well needs to be lowered or raised (i.e. casing cut down or casing riser added) to meet this regulation, a permit from the Division is required before work can start.

The Division makes the following additional recommendations to the local permitting agency, property owner, and developer:

1. To ensure that present and future property owners are aware of (a) the existence of all wells located on the property, and (b) potentially significant issues associated with any improvements near oil or gas wells, the Division recommends that information regarding the

above identified well(s), and any other pertinent information obtained after the issuance of this letter, be communicated to the appropriate county recorder for inclusion in the title information of the subject real property.

2. The Division recommends that any soil containing hydrocarbons be disposed of in accordance with local, state, and federal laws. Please notify the appropriate authorities if soil containing significant amounts of hydrocarbons is discovered during development.

As indicated in PRC § 3106, the Division has statutory authority over the drilling, operation, maintenance, and abandonment of oil, gas, and geothermal wells, and attendant facilities, to prevent, as far as possible, damage to life, health, property, and natural resources; damage to underground oil, gas, and geothermal deposits; and damage to underground and surface waters suitable for irrigation or domestic purposes. In addition to the Division's authority to order work on wells pursuant to PRC §§ 3208.1 and 3224, it has authority to issue civil and criminal penalties under PRC §§ 3236, 3236.5, and 3359 for violations within the Division's jurisdictional authority. The Division does not regulate grading, excavations, or other land use issues.

If during development activities, any wells are encountered that were not part of this review, the property owner is expected to immediately notify the Division's construction site well review engineer in the Coastal district office, and file for Division review an amended site plan with well casing diagrams. The District office will send a follow-up well evaluation letter to the property owner and local permitting agency.

Should you have any questions, please contact me at (805) 937-7246 or via email at Pat.Abel@conservation.ca.gov

Sincerely,

Pat Abel

Coastal District Deputy



The wells listed below are not abandoned to current Division requirements as prescribed by law, and based upon information provided, are projected to be built over or have future access impeded. The Division expects these wells to be reabandoned in compliance with current California law, prior to development activities.

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|---------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111005 52 | Well No. 1 | Conejo Syndicate | Based on currently proposed plans the developer plans to construct a paved road above this well. Based on well records: Oil/gas zone plug is insufficient (CCR § 1723.1) There is no record of a casing shoe plug (CCR § 1723.3) There is no record of a surface plug (CCR § 1723.5) |
| 04111216 95 | Well No. 1 | Trinitas Oil Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well and bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 77 | Well No. 62 | National Oil Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well and bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 82 | Well No. 69 | National Oil Co. | Based on currently proposed plans, infrastructure will be constructed over this well restricting access and grading of the ground surface will bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

The wells listed below are not abandoned to current Division requirements as prescribed by law, and based upon information provided, are projected to be built over or have future access impeded. The Division expects these wells to be reabandoned in compliance with current California law, prior to development activities.

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111217 03 | Well No. 8 | Dr. J. Von Gal-Scale | Based on currently proposed plans the developer plans to construct a paved road above this well. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § |
| | | | 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111005 26 | Well No. 4 | B & B Oil Co. | Based on currently proposed plans the developer plans to construct a paved road above this well. |
| | | | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111217 04 | Well No. 9 | Dr. J. Von Gal-Scale | Based on currently proposed plans the developer plans to construct a paved path above this well and grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| | | | 5. There is no record or a surface plug (GCIX § 1725.5) |
| 04111216 68 | Equity 6 | Equity Petro. Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well. |
| | | | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

The wells listed below are not abandoned to current Division requirements as prescribed by law, and based upon information provided, are projected to be built over or have future access impeded. The Division expects these wells to be reabandoned in compliance with current California law, prior to development activities.

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111005 44 | Unspecified 1 | Camerillo Refining Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well and bring this well out of compliance with CCR § 1723.5. Based on well records: 1. The surface plug is insufficient (CCR § 1723.5) |
| 04111063 94 | Well No. 69 | American Oil Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well and may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111064 50 | Well No. 70 | American Oil Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well and bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111005 45 | Unspecified 2 | Camerillo Refining Co. | Based on currently proposed plans, grading of the ground surface will leave a slope restricting access to this well and bring this well out of compliance with CCR § 1723.5. Based on well records: 1. The surface plug is insufficient (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|---------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111216 91 | Well No. 5 | Trinitas Oil Co. | Based on well records: 1. There is no record of a oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 92 | Well No. 4 | Trinitas Oil Co. | Based on well records: 1. There is no record of a oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 93 | Well No. 3 | Trinitas Oil Co. | Based on well records: 1. There is no record of a oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 94 | Well No. 2 | Trinitas Oil Co. | Based on well records: 1. There is no record of a oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111216 81 | Well No. 68 | National Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 88 | Well No. 4 | Logsdon & Sloan Syndicate No 1 | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 85 | Well No. 1 | Logsdon & Sloan Syndicate No 1 | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 87 | Well No. 3 | Logsdon & Sloan Syndicate No 1 | Based on well records this well has an existing building over it. Based on well records: There is no record of an oil/gas zone plug (CCR § 1723.1) There is no record of a casing shoe plug (CCR § 1723.3) There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111216 65 | Equity 3 | Equity Petro. Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 66 | Equity 4 | Equity Petro. Co. | Based on well records this well has an existing building over it. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111217 02 | Well No. 7 | Dr. J. Von Gal-Scale | Based on well records this well has an existing parking lot over it. Based on well records: There is no record of an oil/gas zone plug (CCR § 1723.1) There is no record of a casing shoe plug (CCR § 1723.3) There is no record of a surface plug (CCR § 1723.5) |
| 04111022 51 | Well No. 18 | Internation al Oil Devel Inc. Lt | Based on well records this well has an existing parking lot over it. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111005 23 | Well No. 1 | B & B Oil Co. | Based on well records this well has an existing parking lot over it. |
| | | | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111005 54 | Well No. 1 | Charles E. Clinton | Based on well records this well has an existing parking lot over it. |
| | | | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111005 25 | Well No. 3 | B & B Oil Co. | Based on well records this well has an existing parking lot over it. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 72 | Equity 10 | Equity Petro. Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111217 08 | Well No. 13 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111217 09 | Well No. 15 | Dr. J. Von Gal-Scale | Based on well records: 1. The surface plug is insufficient (CCR § 1723.5) |
| 04111216 97 | Well No. 2 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111005 37 | Viking 1 | Burns Oil Co. | Based on well records: 1. The surface plug is insufficient (CCR § 1723.5) |



| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|--------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111022 67 | Well No. 1 | Rio Virgin Oil Syndicate | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111063 84 | Well No. 58 | American Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111022 68 | Well No. 2 | Rio Virgin Oil Syndicate | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111063 98 | Well No. 19 | Adolfo Camarillo | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111022 63 | Well No. 59 | National Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111005 38 | Viking 2 | Burns Oil Co. | Based on well records: 1. The surface plug is insufficient (CCR § 1723.5) |
| 04111005 39 | Viking 3 | Burns Oil Co. | Based on well records: 1. The oil/gas zone plug is insufficient (CCR § 1723.1) 2. The casing shoe plug is insufficient (CCR § 1723.3) 3. The surface plug is insufficient (CCR § 1723.5) |
| 04111216 98 | Well No. 3 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |



| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111217 33 | Well No. 1 | G. W. Chort | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 78 | Well No. 64 | National Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111022 19 | Unspecified 1 | Hutchinson Bros. & Tee | Based on well records: 1. The oil/gas zone plug is insufficient (CCR § 1723.1) 2. The casing shoe plug is insufficient (CCR § 1723.3) 3. The surface plug is insufficient (CCR § 1723.5) |
| 04111217 10 | Well No. 16 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|---------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111216 99 | Well No. 4 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 63 | Equity 1 | Equity Petro. Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111064 51 | Unspecified 22B | Internation al Industrial Corp. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 79 | Well No. 65 | National Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |



| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111216 80 | Well No. 66 | National Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111022 52 | Unspecified 1 | L. A. Basin Oil Co. | Based on well records: 1. The oil/gas zone plug is insufficient (CCR § 1723.1) 2. There is no record of a surface plug (CCR § 1723.5) |
| 04111217 00 | Well No. 5 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 64 | Equity 2 | Equity Petro. Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111216 86 | Well No. 2 | Logsdon & Sloan Syndicate No 1 | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 67 | Equity 5 | Equity Petro. Co. | Based on currently proposed plans, grading of the ground surface will bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 83 | Well No. 70 | National Oil Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 89 | Well No. 5 | Logsdon & Sloan Syndicate No 1 | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-----------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111217 05 | Well No. 10 | Dr. J. Von Gal-Scale | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 90 | Well No. 6 | Logsdon & Sloan Syndicate No 1 | Based on currently proposed plans, grading of the ground surface will bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 84 | Well No. 71 | National Oil Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 74 | Well No. 58 | National Oil Co. | Based on currently proposed plans this well is adjacent to the redesigned golf course. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111022 64 | Well No. 63 | National Oil Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 69 | Equity 7 | Equity Petro. Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111217 06 | Well No. 11 | Dr. J. Von Gal-Scale | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111022 58 | Well No. 51 | National Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|---------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111022 57 | Well No. 52 | National Oil Co. | Based on currently proposed plans this well is adjacent to the redesigned golf course. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111022 59 | Well No. 56 | National Oil Co. | Based on currently proposed plans, grading of the ground surface will bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111216 73 | Well No. 57 | National Oil Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111063 85 | Well No. 60 | American Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|---------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 04111063 86 | Well No. 61 | American Oil Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111063 87 | Well No. 62 | American Oil Co. | Based on currently proposed plans, grading of the ground surface may bring this well out of compliance with CCR § 1723.5. Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| 04111063 95 | Well No. 71 | American Oil Co. | Based on well records: 1. There is no record of an oil/gas zone plug (CCR § 1723.1) 2. There is no record of a casing shoe plug (CCR § 1723.3) 3. There is no record of a surface plug (CCR § 1723.5) |
| | | | |

Wells Abandoned to Current Division Requirements as Prescribed by Law & Not Projected to be Built Over or Have Future Access Impeded

| API | Well Designation | Operator | Well Evaluations |
|----------------|------------------|-------------------------------|------------------|
| 04111022 50 | Well No. 1 | Harold B. Landoth et al | |
| | | | |
| | | | |
| | | | |